

25 MARCH 2022

11 STONEYTON TERRACE, ABERDEEN, AB21 9HA

HOME REPORT



MCCLELLAND-JONES

HOME REPORT CONTENTS

1. Single Survey
2. Energy Performance Certificate
3. Property Questionnaire (as provided by the Property's owner)
4. Terms & Conditions



SINGLE SURVEY

survey report on:

Property address	11 Stoneyton Terrace Bucksburn Aberdeen AB21 9HA
Customer	Ms Isabel McGinty
Customer address	11 Stoneyton Terrace Bucksburn Aberdeen AB21 9HA
Prepared by	Mark McClelland-Jones, AssocRICS
Date of inspection	25th March 2022

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a first floor two bedroom flat in a low rise block, set in communal gardens. The property was originally constructed for the local authority.
Accommodation	The Accommodation comprises the following:- Ground Floor: Hallway, Living Room, Two Bedrooms, Shower Room, Kitchen.
Gross internal floor area (m²)	The gross internal floor area extends to 72m ² or thereby.
Neighbourhood and location	The property is located in an established residential area within an Aberdeen suburb. A full range of amenities are available locally.
Age	Approximately 55 years.
Weather	It was dry and sunny at the time of inspection.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. None.

Single Survey

<p>Roofing including roof space</p>	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>The main roof is assumed to be flat and covered with mineral roofing felt and bitumen or similar.</p> <p>Main roof space access is via a hatch at the top of the common stair. At the time of inspection this was locked and a roof inspection was not possible.</p>
<p>Rainwater fittings</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Rainwater fittings are integrated into the building's structure and could not be accessed at the time of inspection.</p>
<p>Main walls</p>	<p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main external walls are of a non-traditional construction type comprising steel and/or concrete framework with walls clad in a Large Panel System. This construction method involves off-site production and elements are then fixed in place.</p>
<p>Windows, external doors and joinery</p>	<p>Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.</p> <p>Windows are modern double glazed uPVC framed units.</p> <p>The external access door from the close is a modern uPVC composite unit.</p>
<p>External decorations</p>	<p>Visually inspected.</p> <p>External decorations comprise painted surfaces.</p>
<p>Conservatories / porches</p>	<p>Visually inspected.</p> <p>None.</p>
<p>Communal areas</p>	<p>Visually inspected.</p> <p>The flatted building is approached via a shared walkway to a double timber & part-glazed door with a security access panel; this leads to a shared concrete stairway.</p> <p>The building is surrounded by communal gardens.</p> <p>There is a refuse chute on the top floor.</p>
<p>Garages and permanent outbuildings</p>	<p>Visually inspected.</p> <p>None.</p>
<p>Outside areas and boundaries</p>	<p>Visually inspected.</p> <p>None. Communal gardens only.</p>

Single Survey


Ceilings	<p>Visually inspected from floor level.</p> <p>Ceilings throughout are plasterboard and/or fibreboard.</p>
Internal Walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Internal walls and partitions throughout are plasterboard and/or fibreboard and plastered masonry.</p>
Floors including sub floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Floors are mainly solid.</p> <p>Floors have fully fitted floor coverings.</p> <p>It will be appreciated that due to fitted floor coverings we cannot guarantee that unexposed flooring is free from defects.</p>
Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances.</p> <p>Internal doors, door surrounds and skirting boards are timber.</p> <p>Kitchen fittings consist of modern floor and wall-mounted units with composite worktops.</p> <p>There are various timber built-in cupboards and wardrobes.</p>
Chimney breasts and fireplaces	<p>Visually inspected.</p> <p>None.</p>
Internal decorations	<p>Visually inspected.</p> <p>Internal decoration comprises painted and papered surfaces.</p>
Cellars	<p>None.</p>
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>A mains supply of electricity is connected to the property.</p> <p>The circuit breaker consumer unit and meter are located in a hall cupboard.</p> <p>The switch sockets are plastic & metal and socket outlets are plastic & metal 13 Amp square pin sockets.</p> <p>Visible wiring is sheathed with PVC.</p>
Gas	<p>Visually inspected without removing fittings. No tests whatsoever were carried out to the system.</p> <p>Mains gas is connected to the property.</p> <p>The meter is located in a hall cupboard.</p>

Single Survey

Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property is connected to a public mains water supply.</p> <p>The Shower Room has a modern shower, basin and w.c.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property is centrally heated, and hot water provided, by means of a modern wall mounted gas-fired combination condensing boiler located within the boiler cupboard in the kitchen.</p> <p>Heating to all rooms is provided by modern steel radiators.</p>
Drainage	<p>Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.</p> <p>The property is connected to mains drainage.</p>
Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The property has smoke detectors.</p> <p>Scottish Government regulations introduced in February 2022 stipulate that every home must have: one smoke alarm in the living room or the room used most, one smoke alarm in every hallway or landing and one heat alarm in the kitchen. All smoke and heat alarms should be mounted on the ceiling and be interlinked. If carbon-fuelled appliances are fitted – like a boiler, fire, heater or flue – in any room, a carbon monoxide detector must be fitted in that room, but this does not need to be linked to the fire alarms.</p>
Any additional limits to inspection	<p>This report does not constitute a full and detailed description of the property and a structural investigation was not carried out.</p> <p>No removal of internal linings has been carried out in order to ascertain the condition of hidden parts and no warranty can be given regarding the areas not specifically referred to in this report.</p> <p>The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance.</p>

Single Survey

Sectional Diagram showing elements of a typical house

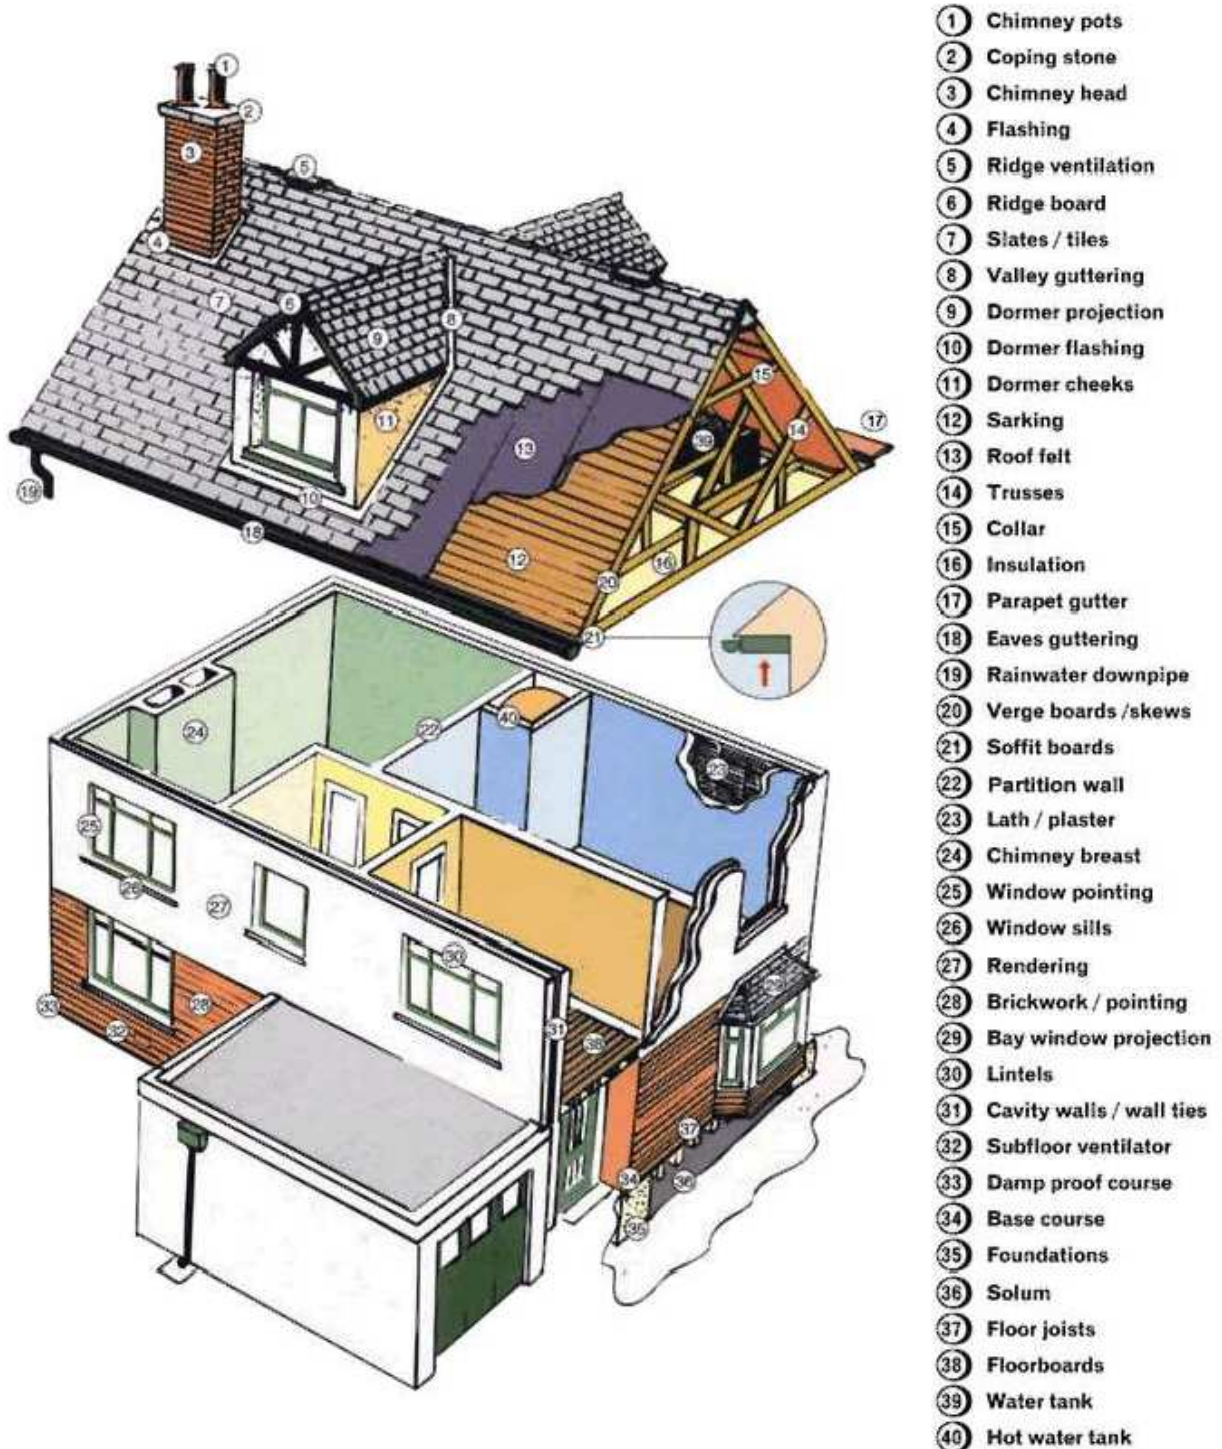

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. Condition

Single Survey

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
Category 2
Repairs or replacement requiring future attention, but estimates are still advised.
Category 1
No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	There is evidence of previous movement in the form of localised hairline cracking to the external building fabric. On the basis of a limited single inspection, no further significant movement is anticipated.

Dampness, rot and infestation	
Repair category	1
Notes	An electronic moisture meter was used to measure levels of dampness, at random locations, to lower wall surfaces and floors, where accessible and without moving furniture or lifting floor coverings, if present. No dampness, rot or infestation encountered.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	1 (based on a limited inspection)
Notes	Bituminous felt roof cover typically has a life of approximately 25 years. The Seller advised that the roof was re-covered more recently.

Rainwater fittings	
Repair category	-
Notes	Not inspected.

Main walls	
Repair category	2
Notes	Some panels have cracks and are damaged.

Windows, external doors and joinery	
Repair category	1

Single Survey

Notes	No obvious significant defects noted to windows, external doors and joinery.
External decorations	
Repair category	1
Notes	No obvious significant defects noted to external decorations. Some painted surfaces are weathered in places.
Conservatories/porches	
Repair category	-
Notes	Not applicable.
Communal areas	
Repair category	2
Notes	Windows to common areas have deteriorated. Paintwork to internal common walls has deteriorated.
Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.
Outside areas and boundaries	
Repair category	-
Notes	Not applicable.
Ceilings	
Repair category	1
Notes	No obvious significant defects noted to ceilings.
Internal Walls	
Repair category	1
Notes	No obvious significant defects noted to internal walls.
Floors including sub-floors	
Repair category	1
Notes	No obvious significant defects noted to flooring, within the limitations imposed by fully fitted floor coverings.
Internal joinery and kitchen fittings	
Repair category	1
Notes	No obvious significant defects noted to internal joinery and kitchen fittings.
Chimney breasts and fireplaces	
Repair category	-

Single Survey

Notes	Not applicable.
Internal decorations	
Repair category	1
Notes	Internal decorations are fresh throughout.
Cellars	
Repair category	-
Notes	Not applicable.
Electricity	
Repair category	1
Notes	<p>It is likely that only properties recently constructed or rewired will have electrical installations that fully comply with current regulations.</p> <p>It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.</p> <p>The electrical system is modern.</p>
Gas	
Repair category	1
Notes	<p>No obvious significant defects noted.</p> <p>It is recommended best practice that all gas installations should be checked periodically. This should be regarded as a routine safety and maintenance check.</p>
Water, plumbing and bathroom fittings	
Repair category	1
Notes	No obvious significant defects noted to accessible plumbing or sanitary fittings.
Heating and hot water	
Repair category	1
Notes	No obvious significant defects noted to the heating system or hot water system, although these have not been tested.
Drainage	
Repair category	1
Notes	No obvious significant defects noted to the drainage system, within the limitations of the inspection.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer the previous comments for detailed information.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	-
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	2
Garages and permanent outbuildings	-
Outside areas and boundaries	-
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Single Survey

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	First floor
2. Are there three steps or fewer to a main entrance door of the property?	No
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	No
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	Yes
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

Single Survey

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Reference to Titles will confirm the exact ownership, maintenance and liability of boundaries.

The building is of non-traditional Large Panel System construction and would not be suitable security for most mortgage lenders.

Normal local practice is for common repairs to be shared on an equitable basis. This has been assumed to be the position in this case.

Estimated reinstatement cost for insurance purposes

We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than:

£200,000 (Two hundred thousand pounds).

The sum provided is an opinion of an appropriate figure, at the date of inspection, for which the property and, if relevant, substantial outbuildings should be insured against total destruction. The sum reflects a reinstatement amount, assuming reconstruction of the property in its existing design and using the same/similar materials. No allowance has been made for VAT, less professional fees. No allowance has been provided for inflation during the insurance period or during reconstruction works. The re-building cost for insurance purposes is for the subject property only and is given solely as a guide, as it is assumed the building as a whole is insured under a single policy. Further discussions with insurers is advised.


Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 25th March 2022 is:

£75,000 (Seventy five thousand pounds sterling).

The market has recovered from COVID-19 uncertainty. Due to lending restrictions on subject property type, there is more limited demand for this and similar properties in this area.

Single Survey

Report author	Mark McClelland-Jones, AssocRICS AssocRICS Registered Valuer
Address	Balgownie, Main Street, Urquhart, Elgin, IV30 8LG
Signed	
Date of report	25th March 2022

Energy Performance Certificate (EPC)

Scotland

Dwellings

11 STONEYTON TERRACE, ABERDEEN, AB21 9HA

Dwelling type: Mid-floor flat
Date of assessment: 25 March 2022
Date of certificate: 28 March 2022
Total floor area: 71 m²
Primary Energy Indicator: 213 kWh/m²/year

Reference number: 2653-1014-3207-5292-6204
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly

Estimated energy costs for your home for 3 years*

£1,770

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

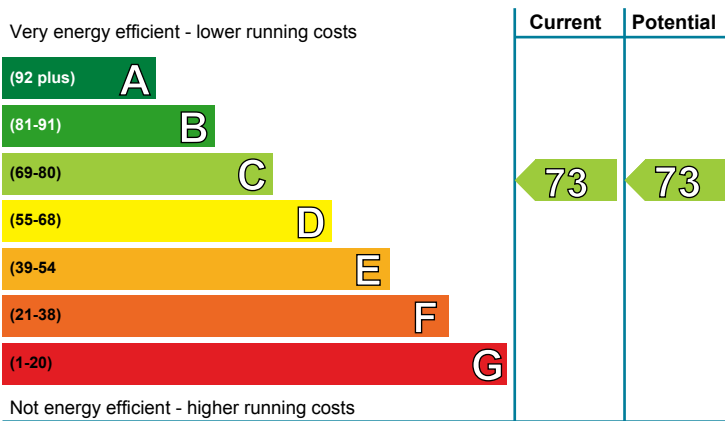


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (73)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

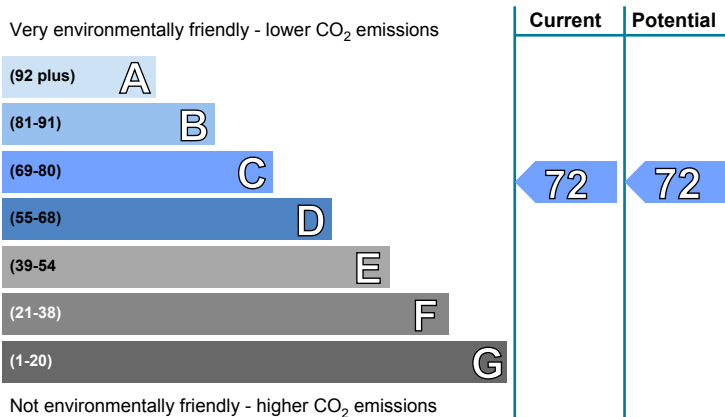

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (72)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

There are currently no improvement measures recommended for your home.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	System built, as built, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Roof	(another dwelling above)	—	—
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and boiler energy manager	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 38 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.7 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,302 over 3 years	£1,302 over 3 years	Not applicable
Hot water	£276 over 3 years	£276 over 3 years	
Lighting	£192 over 3 years	£192 over 3 years	
Totals	£1,770	£1,770	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

None

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	7,508	N/A	N/A	N/A
Water heating (kWh per year)	2,020			

Addendum

This dwelling is a system built property or some of its walls are of non-conventional construction and requires further investigation to establish the type of construction, the type of wall insulation best suited (cavity insulation or internal/external insulation) and the savings it might deliver. Please contact the Home Energy Scotland hotline on 0808 808 2282 to find out more.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Mark McClelland-Jones
Assessor membership number:	EES/020000
Company name/trading name:	EPC Moray
Address:	Balgownie, Main Street Urquhart Moray Elgin IV30 8LG
Phone number:	07788 276861
Email address:	mcclellandjones@icloud.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

property questionnaire

Property address	11 Stoneyton Terrace Bucksburn Aberdeen AB21 9HA
Seller(s)	Ms Isabel McGinty.
Completion date of property questionnaire	21.03.22

property questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership <p style="text-align: right; margin-right: 100px;">21 years</p>		
	How long have you owned the property? 11 years		
2.	Council tax		
	Which Council Tax band is your property in? (Please circle) <p>(A) B C D E F G H</p>		
3.	Parking		
	What are the arrangements for parking at your property? (Please tick all that apply) <ul style="list-style-type: none"> • Garage <input type="checkbox"/> • Allocated parking space <input type="checkbox"/> • Driveway <input type="checkbox"/> • Shared parking <input type="checkbox"/> • On street <input checked="" type="checkbox"/> • Resident permit <input type="checkbox"/> • Metered parking <input type="checkbox"/> • Other (please specify): <input style="width: 300px; height: 20px;" type="text"/> 		
4.	Conservation area		
	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 80%; padding: 5px;"> Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? </td> <td style="width: 20%; padding: 5px; text-align: center;"> Yes/No/ Don't know No </td> </tr> </table>	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes/No/ Don't know No
Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes/No/ Don't know No		

property questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes/No <input checked="" type="radio"/>
6.	Alterations/additions/extensions	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p>	Yes/No <input checked="" type="radio"/>
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	Yes/No
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	Yes/No <input checked="" type="radio"/>
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes/No <input checked="" type="radio"/>
	(ii) Did this work involve any changes to the window or door openings?	Yes/No <input checked="" type="radio"/>
	<p>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p> <p style="text-align: center;">June 2015</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	

property questionnaire

7.	Central heating	
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).</p> <p>If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>If you have answered yes, please answer the three questions below:</p> <p>i) When was your central heating system or partial central heating system installed?</p> <p>(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract:</p> <p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p>	<p>Yes/No/Partial</p> <p>Gas central heating</p> <p>Approx 2014</p> <p>Yes/No Aberdeen Heating</p>
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes/No
9.	Issues that may have affected your property	
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p>If you have answered yes, is the damage the subject of any outstanding insurance claim?</p>	<p>Yes/No</p> <p>Yes/No</p>
b.	<p>Are you aware of the existence of asbestos in your property?</p> <p>If you have answered yes, please give details:</p>	Yes/No

property questionnaire

10. Services

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas or liquid petroleum gas	✓	SSE
Water mains or private water supply		
Electricity	✓	SSE
Mains drainage		
Telephone	✓	BT
Cable TV or satellite	✓	BT
Broadband	✓	BT

b. Is there a septic tank system at your property?

Yes/No

If you have answered yes, please answer the two questions below:

(i) Do you have appropriate consents for the discharge from your septic tank?

Yes/No/
Don't know

(ii) Do you have a maintenance contract for your septic tank?

Yes/No

If you have answered yes, please give details of the company with which you have a maintenance contract:

property questionnaire

11. Responsibilities for shared or common areas		
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	<p>Yes/No/ Don't know</p>
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p> <p><i>I pay 1/2 of any repairs</i></p>	<p>Yes/No/ Not applicable</p>
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<p>Yes/No</p>
d.	<p>Do you have the right to walk over any of your neighbours' property – for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<p>Yes/No <i>Unsure</i></p>
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<p>Yes/No <i>Unsure</i></p>
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	<p>Yes/No</p>
12. Charges associated with your property		
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	<p>Yes/No</p>

property questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p>Yes/No/ Don't know</p> <p>Yes/No/ Don't know</p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p> <p style="text-align: center;">None</p>	
13. Specialist works		
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	<p>Yes/No</p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p>	<p>Yes/No</p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p>Yes/No</p>

property questionnaire

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost
(iv)	National House Building Council (NHBC)	No	Yes	Don't know	With title deeds	Lost
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
c.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:					Yes/No NO
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:					Yes/No/Don't know NO

property questionnaire

16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a.	advising that the owner of a neighbouring property has made a planning application?	Yes/No <input checked="" type="radio"/> No
b.	that affects your property in some other way?	Yes/No <input checked="" type="radio"/> No
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes/No <input checked="" type="radio"/> No
If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.		

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) : G McGinty

Date: 21/3/22

SINGLE SURVEY TERMS AND CONDITIONS

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the surveyors to provide the Single Survey Report. The Seller has also engaged the surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the surveyors during the conveyancing process which materially affects the valuation stated in the Report, the surveyors reserve the right to reconsider the valuation. Where the surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential property¹

If the surveyors have had a previous business relationship within the past two years with the Seller or Seller/s' Agent or relative to the property, they will be obliged to indicate this by stating yes or no here: **Yes**

The surveyors have a written complaints handling procedure. This is available from the offices of the surveyors at the address stated.

1.2 THE REPORT

The surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection. To date, Purchasers have normally obtained their own report from their chosen surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

the Seller;

any person(s) noting an interest in purchasing the Property from the Seller;

any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;

the Purchaser;

the professional advisers of any of these.

The surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.5 PAYMENT

The surveyors are entitled to refrain from delivering the Report to anyone until the fee and other

charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the chartered surveyor's office at any time before the day of the inspection.

The surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.8 DEFINITIONS

the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;

the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*²

the "Property" is the property which forms the subject of the Report;

the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

a "prospective Purchaser" is anyone considering buying the Property;

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;

the "Seller" is/are the proprietor(s) of the Property;

the "surveyor" is the author of the Report on the Property; and

the "surveyors" are the firm or company of which the surveyor is an employee whose details are set out at the head of the Report.

the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the surveyor who carried out the property inspection and will

describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased.

The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the chartered surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The surveyor cannot of course accept liability for any advice given

by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

“Market Value” The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;

There are no particularly troublesome or unusual legal restrictions;

There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis. Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.



MCCLELLAND-JONES