HOME REPORT

2 STATION ROAD HATTON OF FINTRAY ABERDEEN AB21 0YE



ENERGY PERFORMANCE CERTIFICATE



Energy Performance Certificate (EPC)

Dwellings

Scotland

2 STATION ROAD, HATTON OF FINTRAY, ABERDEEN, AB21 0YE

Dwelling type:Mid-terrace houseDate of assessment:29 March 2018Date of certificate:29 March 2018

Total floor area: 70 m²

Primary Energy Indicator: 280 kWh/m²/year

Reference number: 0162-2311-3473-9228-7615
Type of assessment: RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, oil


You can use this document to:

Compare current ratings of properties to see which are more energy efficient and environmentally friendly

Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,085	See your recommendations
Over 3 years you could save*	£1,098	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

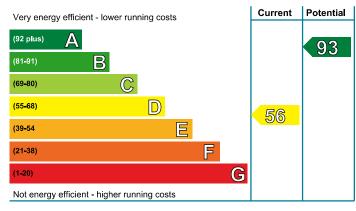


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D** (56). The average rating for EPCs in Scotland is **band D** (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

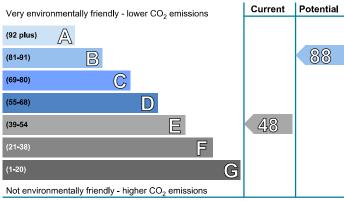

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (48)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years	Available with Green Deal
1 Increase loft insulation to 270 mm	£100 - £350	£42.00	©
2 Internal or external wall insulation	£4,000 - £14,000	£384.00	②
3 Add additional 80 mm jacket to hot water cylinder	£15 - £30	£39.00	②

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.



The Green Deal may allow you to make your home warmer and cheaper to run at no up-front capital cost. See your recommendations report for more details.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whinstone, as built, no insulation (assumed)	***	***
Roof	Pitched, 150 mm loft insulation	****	★★★★ ☆
Floor	Suspended, insulated	_	_
Windows	Fully double glazed	***	***
Main heating	Boiler and radiators, oil	***	★★★☆☆
Main heating controls	Programmer, TRVs and bypass	***	***
Secondary heating	None	_	_
Hot water	From main system	***	***
Lighting	Low energy lighting in 75% of fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 73 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated	energy cost	s for th	is home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,368 over 3 years	£609 over 3 years	
Hot water	£528 over 3 years	£189 over 3 years	You could
Lighting	£189 over 3 years	£189 over 3 years	save £1,098
Tota	ls £2,085	£987	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Da		Indicative cost	Typical saving Rating after improvement		Green	
Re	commended measures	Indicative cost	per year	Energy	Environment	Deal
1	Increase loft insulation to 270 mm	£100 - £350	£14	D 57	E 48	
2	Internal or external wall insulation	£4,000 - £14,000	£128	D 65	D 58	
3	Add additional 80 mm jacket to hot water cylinder	£15 - £30	£13	D 66	D 59	
4	Upgrade heating controls	£350 - £450	£42	C 69	D 62	
5	Replace boiler with new condensing boiler	£2,200 - £3,000	£99	C 76	C 71	
6	Solar water heating	£4,000 - £6,000	£36	C 79	C 75	
7	Replacement glazing units	£1,000 - £1,400	£33	B 81	C 78	
8	Solar photovoltaic panels, 2.5 kWp	£5,000 - £8,000	£262	A 93	B 88	

Measures which have a green deal tick are likely to be eligible for Green Deal finance plans based on indicative costs. Subsidy also may be available for some measures, such as solid wall insulation. Additional support may also be available for certain households in receipt of means tested benefits. Measures which have an orange tick may need additional finance. To find out how you could use Green Deal finance to improve your property, visit www.greenerscotland.org or contact the Home Energy Scotland hotline on 0808 808 2282.

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

3 Hot water cylinder insulation

Increasing the thickness of existing insulation by adding an 80 mm cylinder jacket around the hot water cylinder will help maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. The jacket should be fitted over the top of the existing foam insulation and over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

4 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

5 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

6 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

7 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

8 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	7,388	(258)	N/A	(2,347)
Water heating (kWh per year)	2,893			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Shaun Peddie Assessor membership number: EES/009387

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: 259 Union Street

Aberdeen AB11 6BR

Phone number: 01224 594172

Email address: shaun.peddie@dmhall.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Opportunity to benefit from a Green Deal on this property

Under a Green Deal, the cost of the improvements is repaid over time via a credit agreement. Repayments are made through a charge added to the electricity bill for the property.

To see which improvements are recommended for this property, please turn to page 3. You can choose which improvements you want to install and ask for a quote from an authorised Green Deal provider. They will organise installation by an authorised Green Deal installer. If you move home, the responsibility for paying the Green Deal charge under the credit agreement passes to the new electricity bill payer.

For householders in receipt of income-related benefits, additional help may be available.

To find out more, visit www.greenerscotland.org or call 0808 808 2282.

Repayments **Authorised** Finance at Choose from May be paid stay with the home energy no upfront authorised from savings electricity bill assessment cost installers in energy bills payer

SINGLE SURVEY



survey report on:

Property address	2 STATION ROAD, HATTON OF FINTRAY, ABERDEEN, AB21 0YE
Customer	MRS NORMA BONNER
Customer address	2 STATION ROAD, HATTON OF FINTRAY, ABERDEEN, AB21 0YE
Prepared by	DM Hall
Date of inspection	29th March 2023



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Mid terraced two storey house.
Accommodation	GROUND FLOOR: Hall, living room, kitchen and rear vestibule. FIRST FLOOR: Two bedrooms and shower room.
Gross internal floor area (m²)	70m².
Neighbourhood and location	The property is located on the edge of Hatton of Fintray, a small rural village approximately ten miles northwest of Aberdeen city centre. Locally, there are limited facilities and amenities.
Age	70 years.
Weather	Dry and bright.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	There is a stone chimney stack with clay chimney pots and metal flashings.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is of a pitched timber rafter design with timber sarking board. The roof is clad with slates. There are clay ridge tiles and metal lined valleys. The roof space was inspected via the ceiling hatch in the rear bedroom.

Rainwater fittings	Gutters and downpipes are formed in PVC sections.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The walls are of traditional 600mm solid granite construction, pointed externally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The front entrance door is of PVC panel design with a glazed insert. The rear door is of PVC frame construction and there are PVC casement windows. All windows and doors are equipped with double glazed sealed units. There are PVC fascias and soffit boards around the roof eaves.
External decorations	Visually inspected.
	Low maintenance PVC.
Conservatories / porches	None.
Conservatories / porches Communal areas	
·	None.
Communal areas	None. None.
Communal areas	None. None. Visually inspected.

Ceilings	Visually inspected from floor level.
	The ceilings are lined in plasterboard.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The walls are lined in plasterboard. The gable walls are plastered on the hard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	The floors are of suspended timber construction with tongue and groove timber floorboards on timber joists. A limited sub floor inspection was possible via the floor hatch at the front door. The solum is sealed with a concrete screed and is generally dry. Additional sub floor insulation has been installed.
Internal inium, and hitchen fittings	
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal doors are of a timber panel design. The kitchen is fitted with a range of wall and base units with laminate doors. The kitchen installation incorporates a fitted hob, oven and extractor hood.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	There is a stone feature fireplace surround along the gable in the living room. The fireplace is covered with an electric appliance.
Internal decorations	Visually inspected.
	Wallpaper and paint finishes.
	· • • • • • • • • • • • • • • • • • • •

Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	A mains electricity supply is connected to the property. The distribution board and meter are located in the cupboard over the front door.
Gas	No supply.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	A mains water supply is connected to the property. The plumbing system, where visible, is formed in plastic and copper pipework. There is a main stopcock below the floor hatch at the front door.
	The shower room has a coloured suite comprising a plastic shower cubicle with an electric shower fitting, a pedestal wash hand basin and a close ?? WC.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	An oil fired Meratt central heating boiler is located in the kitchen. The boiler serves a series of radiators installed throughout the property and also provides domestic hot water. There is an insulated copper hot water cylinder in the airing cupboard off the front bedroom.
Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage leads to the public sewer.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	We are advised by the seller that interlinked smoke alarms, carbon monoxide detectors and heat detectors have been installed to comply with recent Scottish Government legislation. It is outwith the scope of this report to check the compliance or functionality of such systems.

Any additional limits to inspection

The property was occupied, furnished and all floors were covered. The inspection of the sub floor was restricted to the area visible from the floor hatch and the inspection of the roof space was limited due to the presence of stored items and thermal insulation.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.


The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Any such materials should not be drilled or disturbed without prior advice from a licensed specialist.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Sectional Diagram showing elements of a typical house

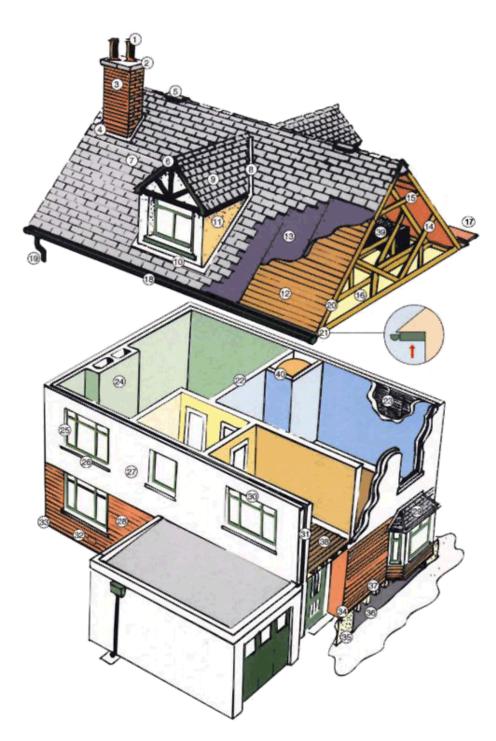

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10) Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- 25) Window pointing
- 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33 Damp proof course
- 34) Base course
- (35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- (39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No evidence of significant movement.

Dampness, rot and infestation	
Repair category	1
Notes	No evidence of significant damp or timber decay.

Chimney stacks	
Repair category	1
Notes	No significant defects evident.

Roofing including roof space	
Repair category	2
Notes	There are a few damaged slates, particularly around the chimney and slate fragments could be seen in gutters. Slate roofs require regular routine maintenance.

Rainwater fittings	
Repair category	1
Notes	No significant defects evident.

Main walls	
Repair category	1
Notes	No significant defects evident.

Windows, external doors and joinery	
Repair category	1
Notes	No significant defects evident.

External decorations	
Repair category	1
Notes	No significant defects evident.

Conservatories/porches	
Repair category	-
Notes	None.

Communal areas	
Repair category	-
Notes	None.

Garages and permanent outbuildings	
Repair category	1
Notes	No significant defects evident.

Outside areas and boundaries	
Repair category	1
Notes	No significant defects evident.

Ceilings	
Repair category	2
Notes	There is a section of cracked/loose ceiling plasterwork in the front bedroom.

Internal walls	
Repair category	1
Notes	No significant defects evident.

Floors including sub-floors	
Repair category	1
Notes	No significant defects evident.

Internal joinery and kitchen fittings	
Repair category	2
Notes	Some of the internal joinery finishes require attention. In particular, there are missing door handles, skirting boards and door frames in parts.

Chimney breasts and fireplaces	
Repair category	1
Notes	No significant defects evident.

Internal decorations	
Repair category	1
Notes	No significant defects evident.

Cellars	
Repair category	-
Notes	None.

Electricity	
Repair category	2
Notes	There are some older style electrical facings to the lighting circuit and an older style distribution board.
	It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	-
Notes	None.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	No significant defects evident.

Heating and hot water	
Repair category	1
Notes	It is good practice to have the central heating system checked immediately upon taking occupation.

Drainage	
Repair category	1
Notes	No significant defects evident.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	2
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	-
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes No X
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

There is an additional exclusive area of garden ground separate from the immediate garden ground surrounding the house accessed over the garden ground of the neighbouring property.

Estimated reinstatement cost for insurance purposes

£225,000 (Two Hundred and Twenty Five Thousand Pounds).

Valuation and market comments

The Market Value as at the date of inspection is £135,000 (One Hundred and Thirty Five Thousand Pounds).

The market is performing adequately and there is demand for properties of this type.

This is a Replacement Single Survey. The original inspection was carried out on 29th March 2018.

Signed	Security Print Code [378995 = 5718] Electronically signed
Report author	SHAUN PEDDIE
Company name	DM Hall
Address	4-5 Union Terrace, Aberdeen, AB10 1NJ
Date of report	21st April 2023

Mortgage Valuation Report



Property Address	
Address Seller's Name Date of Inspection	2 STATION ROAD, HATTON OF FINTRAY, ABERDEEN, AB21 0YE MRS NORMA BONNER 29th March 2023
Property Details	
Property Type	X House Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	□ Detached □ Semi detached □ Mid terrace □ End terrace □ Back to back □ High rise block □ Low rise block □ Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, X Yes No nilitary, police?
Flats/Maisonettes onl	ly Floor(s) on which located No. of floors in block Lift provided? Yes No. of units in block
Approximate Year of	Construction 1950
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	1 Living room(s) 2 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 1 WC(s) 0 Other (Specify in General remarks)
Gross Floor Area (ex	cluding garages and outbuildings) 70 m² (Internal) m² (External)
Residential Element ((greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage Available on site?	□ Double garage ▼ Parking space □ No garage / garage space / parking space ▼ Yes □ No
Permanent outbuildin	igs:

Mortgage Valuation Report

Construction							
Walls	Brick	X Stone	Concrete	Timber frame	Othe	r (specify in Gen	eral Remarks)
Roof	Tile	X Slate	Asphalt	 Felt	Othe	r (specify in Gen	eral Remarks)
Special Risks							
Has the property	suffered stru	ctural movemen	nt?			Yes	X No
If Yes, is this rece	ent or progres	ssive?				Yes	No
Is there evidence, immediate vicinity		eason to anticip	ate subsidence	, heave, landslip o	or flood in the	e Yes	X No
If Yes to any of th	e above, pro	vide details in G	Seneral Remark	s.			
Service Connec	otion						
						al a	11 4
Based on visual ir of the supply in G	nspection onl eneral Rema	ly. If any service irks.	es appear to be	non-mains, pleas	e comment of	on the type ar	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	Mains	Private	X None
Central Heating	X Yes	Partial	None				
Brief description of	of Central He	ating:					
Oil fired radiator	heating.						
Site							
Apparent legal iss	sues to be ve	rified by the cor	nveyancer. Plea	ise provide a brief	description	in General Re	emarks.
Rights of way	Shared dr	ives / access	X Garage or other	amenities on separate	e site Sha	red service conn	ections
Ill-defined boundar	ries	Agricultu	ral land included wi	th property	Othe	er (specify in Ge	neral Remarks)
Location							
Residential suburb	Re	esidential within tow	n / city Mixe	ed residential / comme	rcial Mai	nly commercial	
X Commuter village	Re	emote village	Isola	ited rural property	Othe	er (specify in Ge	neral Remarks)
Planning Issues	S						
Has the property I	been extende	ed / converted /	altered?	Yes X No			
If Yes provide det	ails in Gener	al Remarks.	_				
Roads							
X Made up road	Unmade ro	ad Partly c	ompleted new road	Pedestrian a	access only	Adopted	Unadopted

Mortgage Valuation Report

General Remarks
The property is generally in reasonable order given its age and style although some items of routine repair and maintenance are required.
There is an additional exclusive area of garden ground separate from the immediate garden ground surrounding the house accessed over the garden ground of the neighbouring property.
Essential Repairs
None.
Estimated cost of essential repairs £ Retention recommended? Yes X No Amount £

Mortgage Valuation Report

The property is mortgageable. Valuations Market value in present condition £ 135,000 Market value on completion of essential repairs
Valuations Market value in present condition £ 135,000
Market value in present condition £ 135,000
·
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary? £ 225,000 Yes X No
Buy To Let Cases
What is the reasonable range of monthly rental income for the property assuming a letting on a 6 £
Is the property in an area where there is a steady demand for rented accommodation of this type?
Declaration
Signed Security Print Code [378995 = 5718] Electronically signed by:-
Surveyor's name SHAUN PEDDIE
Professional qualifications MRICS
Company name DM Hall
Address 4-5 Union Terrace, Aberdeen, AB10 1NJ
Telephone 01224 594172
Fax 01224 574615 Report date 21st April 2023

PROPERTY QUESTIONNAIRE





Seller(s)	FINTRAY BOZION
000.(0)	

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property?
2.	Council tax
	Which Council Tax band is your property in? (Please circle) A B C D E F G H
3.	Parking
	What are the arrangements for parking at your property?
	(Please tick all that apply)
	• Garage
	Allocated parking space
	• Driveway
	Shared parking
	On street
	Resident permit
	Metered parking
	Other (please specify):
'	Conservation area
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes/No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made:	Yes/No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	Yes/No
).	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes/No
	If you have answered yes, please answer the three questions below: (i) Were the replacements the same shape and type as the ones you replaced?	Yes/No
	(ii) Did this work involve any changes to the window or door openings?	Yes/No
	(iii) Please describe the changes made to the windows doors, or patio doc approximate dates when the work was completed): Please give any guarantees which you received for this work to your solic agent.	

7.	Central heating	
a .	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes/No/ Partial
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	011
	If you have answered yes, please answer the three questions below:	
	i) When was your central heating system or partial central heating system installed?	15
	(ii) Do you have a maintenance contract for the central heating system?	Yes/No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	NE
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes/No
9.	Issues that may have affected your property	No
3.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes/No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes/No
).	Are you aware of the existence of asbestos in your property?	Yes/No
	If you have answered yes, please give details:	

10.	Services			

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas or liquid petroleum gas		2
Water mains or private water supply		MAINS
Electricity		-
Mains drainage		
Telephone		-
Cable TV or satellite		×
Broadband		1

b.	Is there a septic tank system at your property?	Yes/No
	If you have answered yes, please answer the two questions below:	
	(i) Do you have appropriate consents for the discharge from your septic tank?	Yes/No/ Don't know
	(ii) Do you have a maintenance contract for your septic tank?	Yes/No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	Yes/No/ Don't know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	Yes/No/ Not applicable
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes/No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	Yes/No
).	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	Yes/No
•	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	Yes/No
12.	Charges associated with your property	
1.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	Yes/No

		1
b.	Is there a common buildings insurance policy?	Yes/No/ Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes/No/ Don't know
C.	Please give details of any other charges you have to pay on a regular upkeep of common areas or repair works, for example to a resident maintenance or stair fund.	llar basis for the nts' association, or
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes/No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	Yes/No
c.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes/No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	be shown in the original estimate.	

	Guarantees					
a.	Are there any guarantees or warrantles for any of the following:					-
(i)	Electrical work	No	Yes	Don/t know	With title deeds	Lost
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost
(iv)	National House Building Council (NHBC)	No	Yes	Don't know	With title deeds	Lost
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost
C.	Are there any outstanding claims und	-	the guarant	tees listed a	above?	Yes/No
15.	Boundaries					
15.	Boundaries So far as you are aware, has any bour last 10 years? If you have answered yes, please give		our propert	ty been mo	ved in the	Yes/ No/ Don't

16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes/No
b.	that affects your property in some other way?	Yes/No
C.	that requires you to do any maintenance, repairs or improvements to your property?	Yes/No
	If you have answered yes to any of a-c above, please give the notices to your estate agent, including any notices which arrive at any time before the date of the purchaser of your property.	

DM Hall Offices

Aberdeen 01224 594172 Galashiels 01896 752009

Livingston 01506 490404

Ayr 01292 286974 Glasgow (North) 0141 332 8615 Musselburgh 0131 665 6782

Cumbernauld 01236 618900

Glasgow (South) 0141 636 4141 Oban 01631 564225

Cupar 01334 844826

Hamilton 01698 284939 Paisley

01698 284939

0141 887 7700

Dumfries 01387 254318

Inverness 01463 241077 Perth

01738 562100

Dundee 01382 873100 Inverurie 01467 624393 Peterhead 01779 470220

Dunfermline 01383 621262

Irvine 01294 311070 Stirling

01786 475785

Edinburgh 0131 477 6000

Kirkcaldy 01592 598200

Elgin

01343 548501

01332 330

Falkirk

01324 628321

DMHALL.CO.UK





